

Page 1 of 3

TEST REPORT

Client

Address

The following sample(s) and sample information was/were submitted and identified by/on the behalf of the client:

Sample Name	: Outdoor speaker	
Sample Type	: XO-9123	
Sample Quantity	: 1pc	
Sample Received Date	: Jun. 21, 2017	
Sample tested Date	: Jun. 23, 2017	

Tested by

Tom Yang

Tom Yang(Yang Zhice)

Jun. 23, 2017

Reviewed by

zyle

Kyle Xiong(Xiong Zhi)

Jun. 23, 2017

Approved by

Taylor . Chen

Taylor Chen(Chen Meng) Authorized Officer

Jun. 23, 2017

Attestation of Global Compliance (Shenzhen) Co., Ltd.

CAUTION:

The test report is effective only with both signature and specialized stamp. The result(s) shown in this report refer only to the sample(s) tested. Without written approval of AGC, this report can't be reproduced except in full.



The results snownain this test report refer only to the sample(s) tested unless otherwise stated and the sample(s) are retained for 30 days only. The document is issued by AGC, this document cannot be reproduced except in full with our prior written permission. The document is available on request and the brief information for its validation can be assessable and confirmed at http://www.agc-cert.com

Attestation of Global Compliance



Report No: AGC10274170601SR01 Report Version:V1.0 Page 2 of 3

TEST REPORT

Test Item: IPX4 test

1) Environment conditions:

Temperature: (23±2)°C Humidity: (50±5)%RH

2) Tested Sample:

Sam	nple No.	Sample Name	Sample Type	Sample Quantity
1	001	Outdoor speaker	XO-9123	1pc

3) Test standard: IEC 60529:1989+A1:1999+A2:2013

4) Test Condition:

- 1. Radius of the tube: 200mm.
- 2. Water flow rate : 0.91L/min.
- 3. The rotation speed of the turntable: 1RPM.
- 4. Test duration: 10min.
- 5. The tube is caused to oscillate through an angle of almost 360° , 180° on either side of the vertical, the time for one complete oscillation (2 × 360°) being about 12 s.

5) Test Equipment:

Equipment Name	Equipment Type	Serial No.	Valid Date to
Waterproof test system	KXT1318	AGE-RE-E020	Dec. 13, 2017

6) Test Results:


Sample No.	Test result description	Conclusion
001	After the test, by visual inspection, there was no water into the sample inside	Pass

The results showed this test report refer only to the sample(s) tested unless otherwise stated and the sample(s) are retained for 30 days only. The document is issued by (GO, this document cannot be reproduced except in full with our prior written permission. The document is available on request and the brief information for its validation can be assessable and confirmed at http://www.agc-cert.com



Report No: AGC10274170601SR01 Report Version:V1.0 Page 3 of 3

TEST REPORT

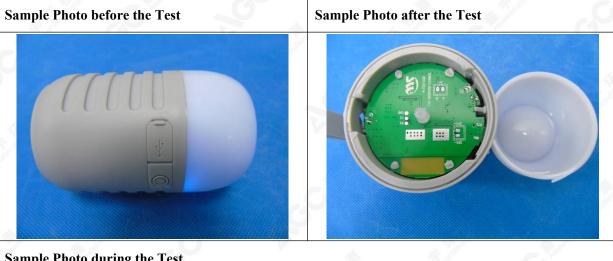

Sample Photo during the Test



*** End of Report ***

Testing laboratory address: 1F., Building C West, Qinyu Industrial Park, Nanchang Community, Baoan Road, Xixiang Street, Baoan District, Shenzhen, China.

CAUTION:

The test report is effective only with both signature and specialized stamp. The result(s) shown in this report refer only to the sample(s) tested. Without written approval of AGC, this report can't be reproduced except in full.

The results showed this test report refer only to the sample(s) tested unless otherwise stated and the sample(s) are retained for 30 days only. The document is issued by AGO, this document is available on request and the brief information for its validation can be assessable and confirmed at http://www.agc-cert.com

