

Production Test Report

SERVICE REFERENCE			
Item No.	P760.041 P760.043 P760.045 P760.046 P760.049	Order No.	PU032219
Supplier Name	S64457	Order quantity	12000 12000 6000 3000 6000
Purchaser	Zlata Jesic	QC Date	11/12/2019
Test By	Luck	Test Date	11/13/2019
TEST RESULT	PASS		
	SEE DETAILS BELOW.		

PVC is a kind of material always accompanied with high-risk chemical substances such as SCCP and Phthalates which are prohibited from using or taking as ingredients to the main substance according to EU legislation requirements.

Suppliers should be informed, as a requirement, all Xindao items should be free of PVC material.

Exceptionally, if a supplier claims a special grade of PVC material which does not contain SCCP or Phthalates, then we need to verify it through a third party lab. However, any possible extra expenses thus entailed shall be borne by the suppliers.

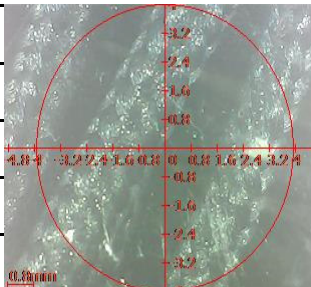
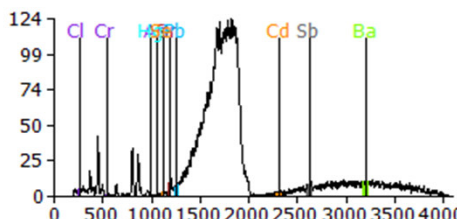
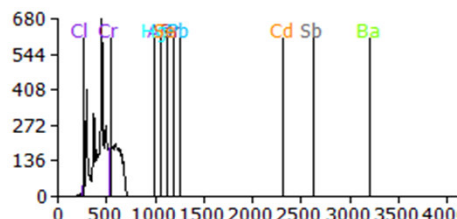
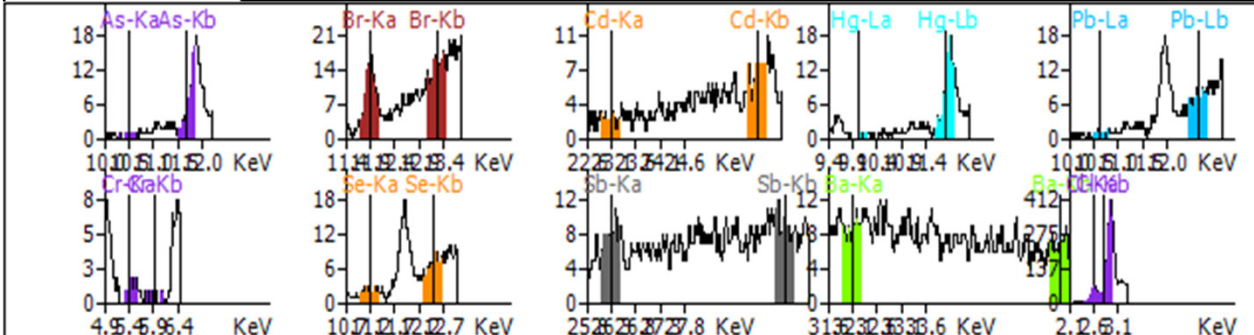
Since we found this shipment is against the EU legislation requirements, Xindao Quality Department suggest reject the shipment until elimination of the risks.

If the shipment has already been on board, Xindao Quality Department suggest to recall the shipment or take action of destruction immediately.

XINDAO



ROHS XRF Report PU032219 P760.04

	PU032219,P760.04,ziper_puller				
Test Time	60(s)	Voltage			
Operator	Admin	Current	311(μA)		
Test Date	2019-11-13 14:12	WorkCurve	PE WorkCurveCl		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cr(ppm)	0.00003	ND	0.00	1000	Pass
Cl(ppm)	8.08333	266.60	7.40	1000	Pass
As(ppm)	0.0003	ND	0.00	1000	Pass
Br(ppm)	0.00615	ND	0.00	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0	ND	0.00	1000	Pass
Sb(ppm)	0.00471	144.02	6.21	1000	Pass
Ba(ppm)	0	ND	0.00	1000	Pass
Spectrum					
					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

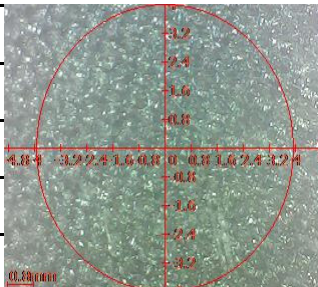
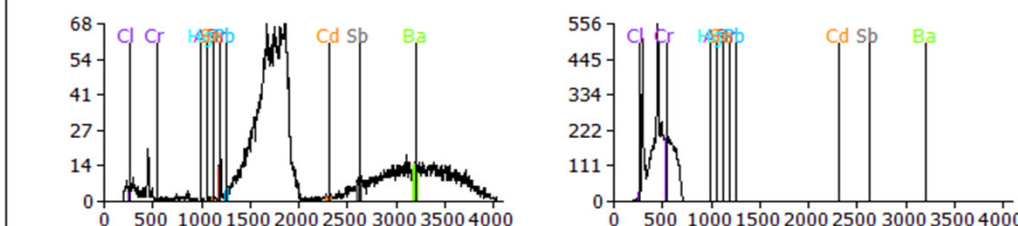
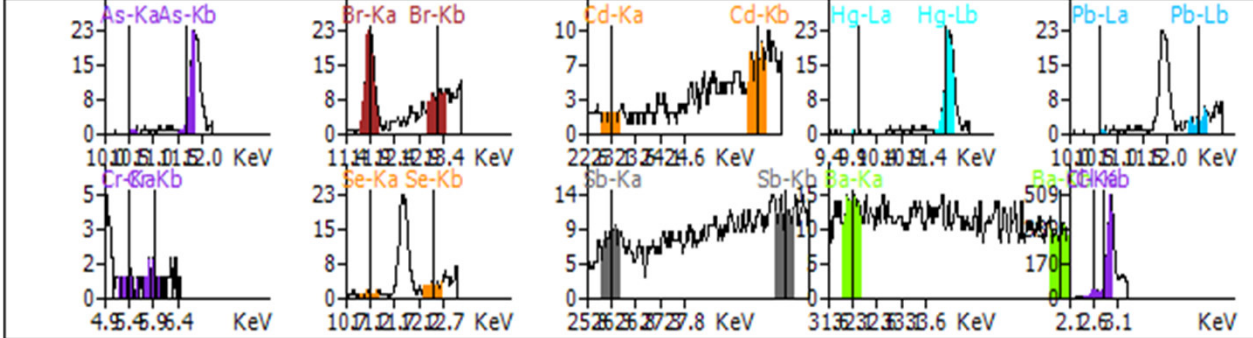
Tel : 021-51093622 Fax : 021-51093699

E-Mail:kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,back_fabric_black				
Test Time	60(s)	Voltage			
Operator	Admin	Current	311(μA)		
Test Date	2019-11-13 13:15	WorkCurve	PVC WorkCurveCl		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cr(ppm)	0.00033	22.23	4.54	1000	Pass
Cl(ppm)	4.03333	58.07	1.89	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0.02053	77.03	3.31	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0.00011	ND	0.00	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0.00008	ND	0.00	1000	Pass
Sb(ppm)	0.00477	ND	0.00	1000	Pass
Ba(ppm)	0.00484	ND	0.00	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

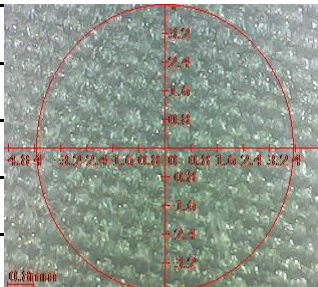
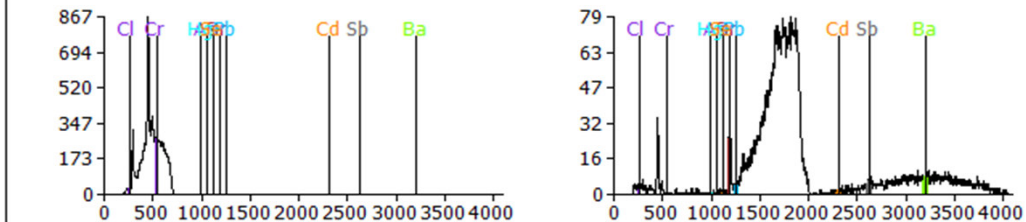
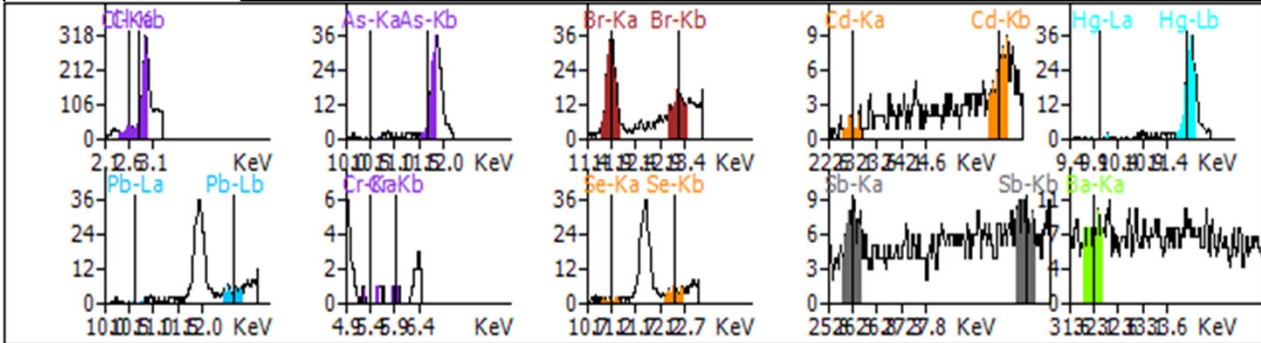
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,main_fabric_black				
Test Time	60(s)	Voltage			
Operator	Admin	Current	610(μA)		
Test Date	2019-11-13 13:08	WorkCurve	WorkCurveCl PE		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cl(ppm)	3.08333	4.68	0.15	1000	Pass
Cr(ppm)	0	ND	0.00	1000	Pass
As(ppm)	0.00006	ND	0.00	1000	Pass
Br(ppm)	0.02482	76.37	2.60	1000	Pass
Cd(ppm)	0.00054	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0	ND	0.00	1000	Pass
Sb(ppm)	0.00767	235.25	11.44	1000	Pass
Ba(ppm)	0	ND	0.00	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

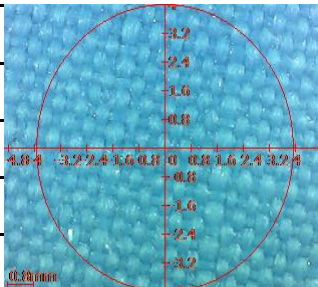
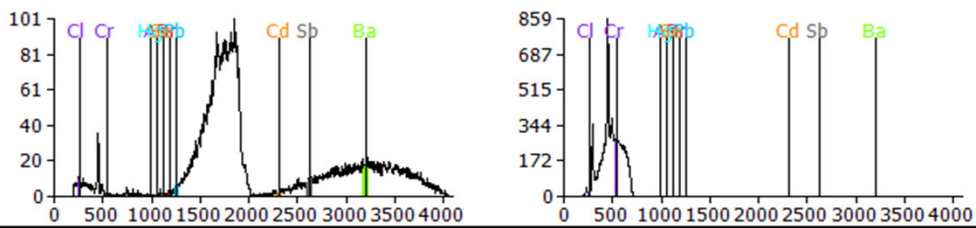
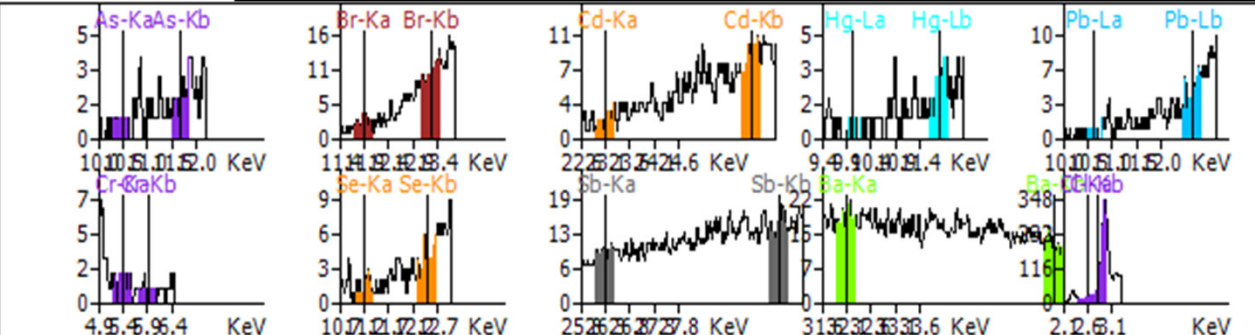
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,main_fabric_blue				
Test Time	60(s)	Voltage			
Operator	Admin	Current	311(μA)		
Test Date	2019-11-13 13:53	WorkCurve	PE WorkCurveCl		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cr(ppm)	0.0002	ND	0.04	1000	Pass
Cl(ppm)	0.08333	ND	0.00	1000	Pass
As(ppm)	0.00029	ND	0.00	1000	Pass
Br(ppm)	0.00115	ND	0.00	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0.00035	ND	0.30	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0.00039	3.63	0.49	1000	Pass
Sb(ppm)	0.0032	97.31	3.63	1000	Pass
Ba(ppm)	0	ND	0.00	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

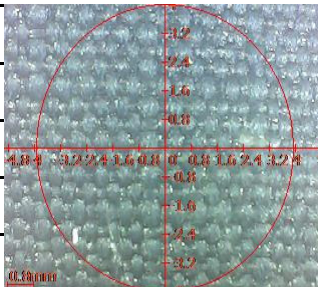
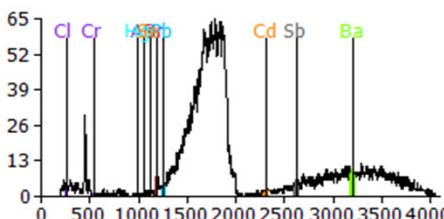
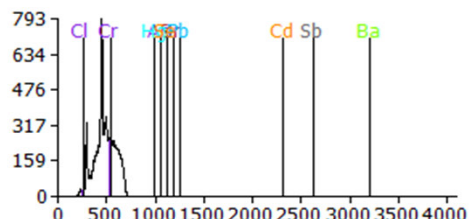
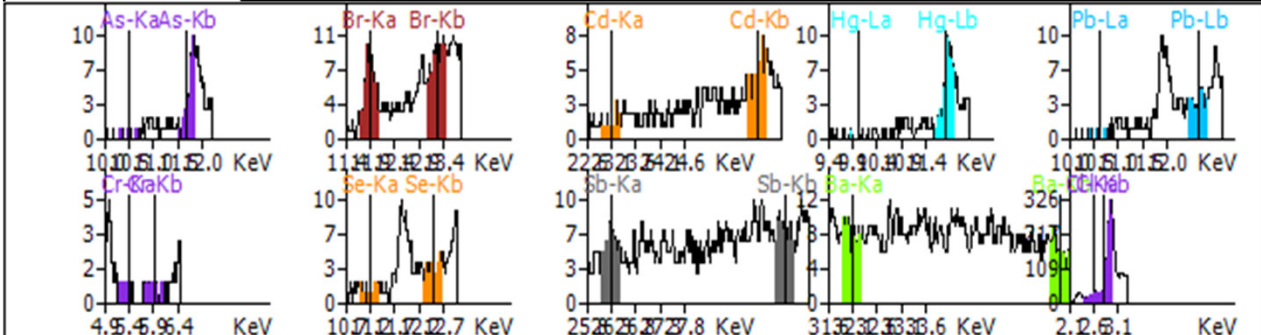
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,main_fabric_navy				
Test Time	60(s)	Voltage			
Operator	Admin	Current	311(μA)		
Test Date	2019-11-13 13:36	WorkCurve	PE WorkCurveCl		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cr(ppm)	0.00022	2.87	0.59	1000	Pass
Cl(ppm)	1.93333	ND	0.00	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0.00633	ND	0.00	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0.00023	ND	0.00	1000	Pass
Se(ppm)	0	ND	0.00	1000	Pass
Sb(ppm)	0.00587	179.77	8.98	1000	Pass
Ba(ppm)	0	ND	0.00	1000	Pass
Spectrum					
					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

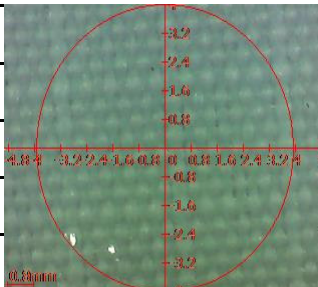
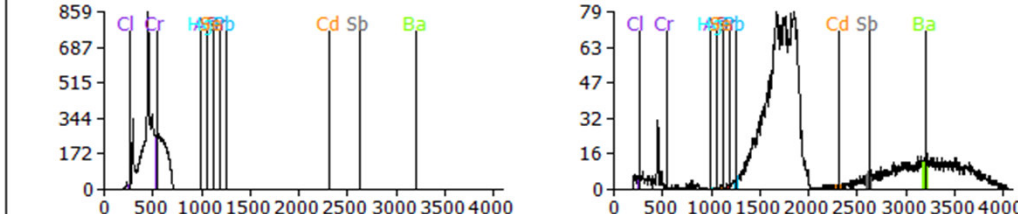
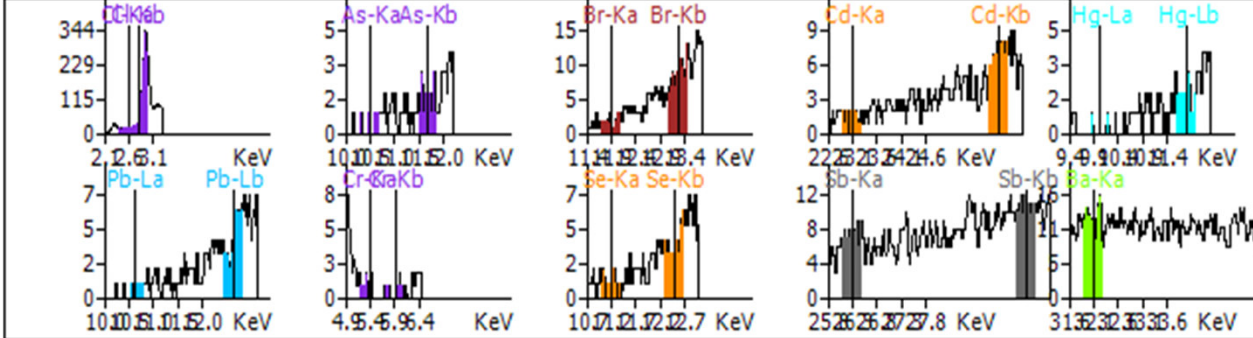
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,main_fabric_white				
Test Time	60(s)	Voltage			
Operator	Admin	Current	609(μA)		
Test Date	2019-11-13 13:23	WorkCurve	WorkCurveCl PE		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cl(ppm)	0	ND	0.00	1000	Pass
Cr(ppm)	0.00026	7.85	1.60	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0	ND	0.00	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0.00095	14.13	2.46	1000	Pass
Sb(ppm)	0.00624	191.25	8.44	1000	Pass
Ba(ppm)	0.00097	ND	0.00	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

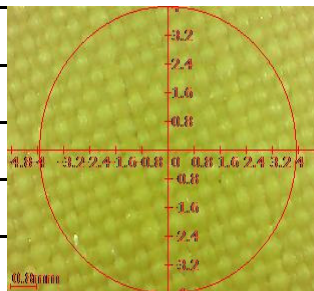
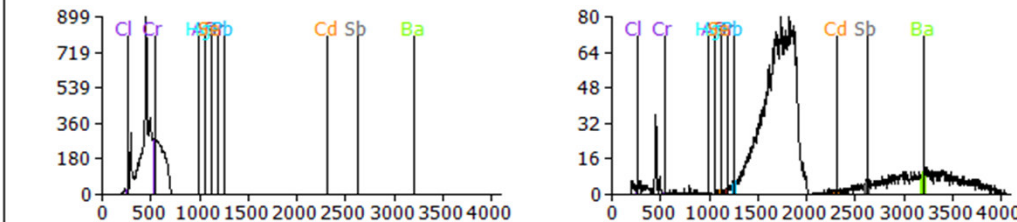
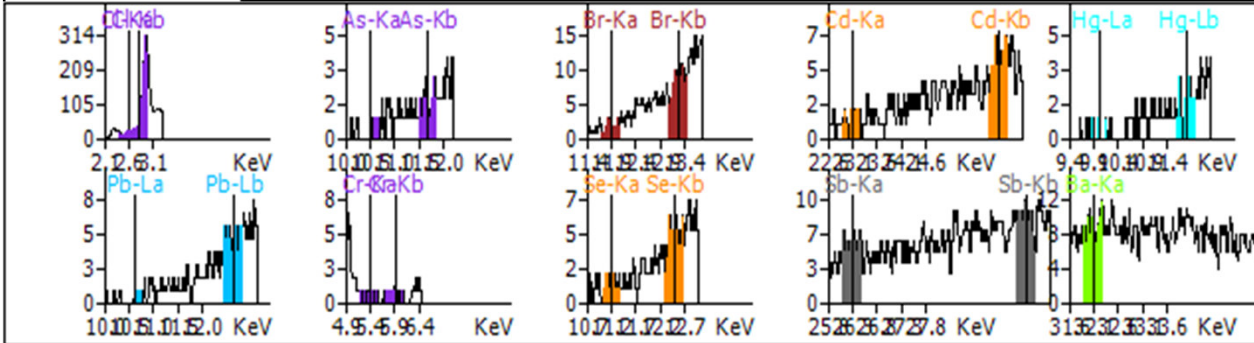
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,main_fabric_yellow				
Test Time	60(s)	Voltage			
Operator	Admin	Current	610(μA)		
Test Date	2019-11-13 13:46	WorkCurve	WorkCurveCl PE		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cl(ppm)	0	ND	0.00	1000	Pass
Cr(ppm)	0.00011	ND	0.00	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0.00017	ND	0.00	1000	Pass
Cd(ppm)	0.00019	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0	ND	0.00	1000	Pass
Se(ppm)	0.00006	ND	0.00	1000	Pass
Sb(ppm)	0.00469	143.35	7.11	1000	Pass
Ba(ppm)	0.00249	89.23	3.50	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

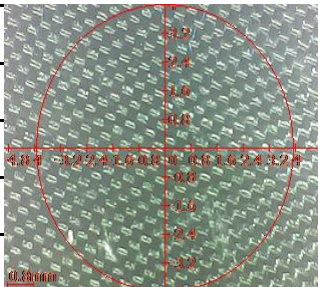
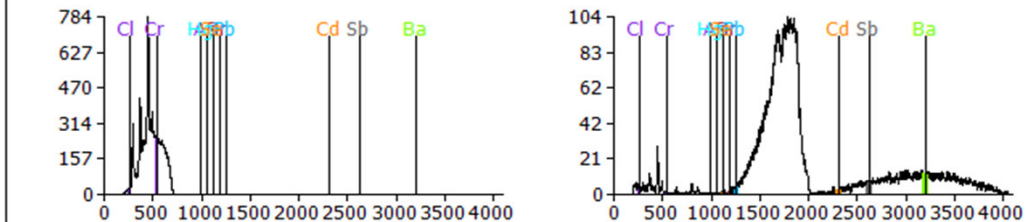
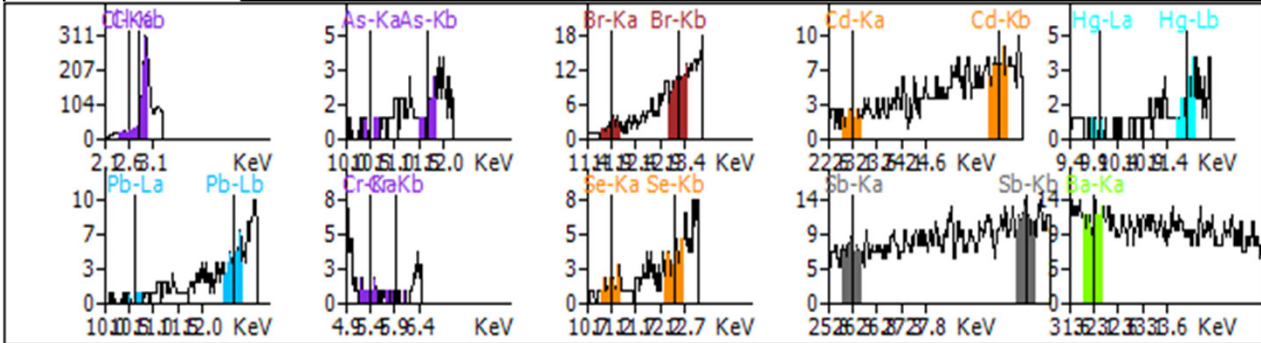
Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report

PU032219 P760.04

	PU032219,P760.04,shouder_back_fabric				
Test Time	60(s)	Voltage			
Operator	Admin	Current	609(μA)		
Test Date	2019-11-13 13:59	WorkCurve	WorkCurveCl PVC		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cl(ppm)	0	ND	0.00	1000	Pass
Cr(ppm)	0	ND	0.00	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0.00055	ND	0.00	1000	Pass
Cd(ppm)	0	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0.00042	ND	0.00	1000	Pass
Se(ppm)	0.00003	ND	0.00	1000	Pass
Sb(ppm)	0.00076	ND	0.00	1000	Pass
Ba(ppm)	0	ND	0.00	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

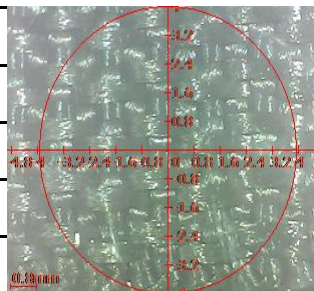
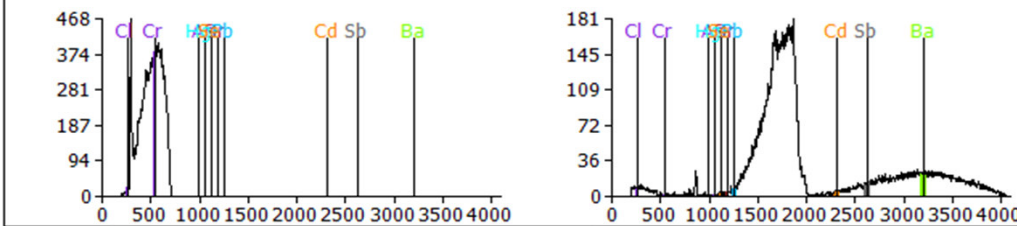
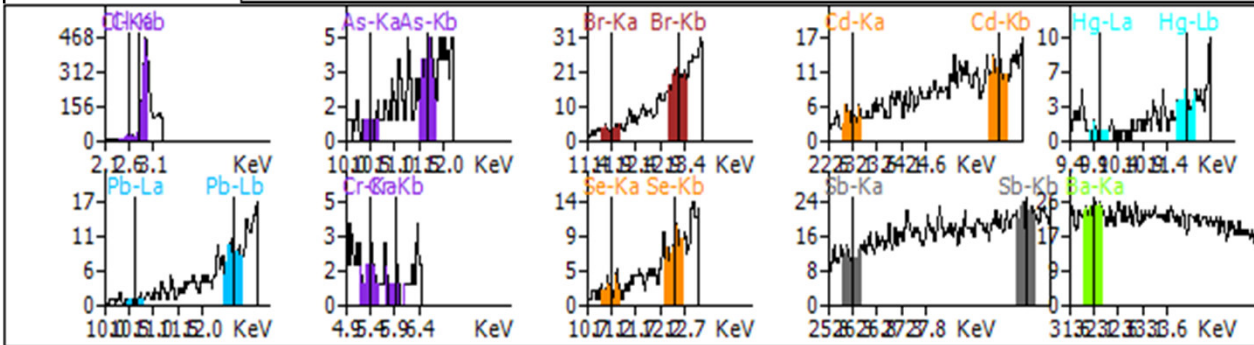
Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>

ROHS XRF Report PU032219 P760.04

	PU032219,P760.04,shoulder_belt				
Test Time	60(s)	Voltage			
Operator	Admin	Current	609(μA)		
Test Date	2019-11-13 14:22	WorkCurve	WorkCurveCl PE		
Mode		Supplier	s		
Element	Intensity	Content(ppm)	Error(ppm)	Limits	Results
Cl(ppm)	0.75	ND	0.00	1000	Pass
Cr(ppm)	0.00019	ND	0.00	1000	Pass
As(ppm)	0	ND	0.00	1000	Pass
Br(ppm)	0	ND	0.00	1000	Pass
Cd(ppm)	0.00034	ND	0.00	100	Pass
Hg(ppm)	0	ND	0.00	1000	Pass
Pb(ppm)	0.00085	ND	0.00	1000	Pass
Se(ppm)	0	ND	0.00	1000	Pass
Sb(ppm)	0	ND	0.00	1000	Pass
Ba(ppm)	0.00291	167.00	4.04	1000	Pass
Spectrum					
					
Note: ND means Concentrations≤2ppm					
XRF tests on surface only.					
The content of "Cr" or "Br" is the total amount of this element.The reading data does not represent.					

Address: 15th floor, LZY Tower, No.4711, Jiao Tong Rd., Shanghai, P.R. China Zip code : 200331

Tel : 021-51093622 Fax : 021-51093699

E-Mail: kevin.zsz@xindao.com

WebSite : : <http://www.xindao.com>